

CERTIFICATE OF THOROUGH EXAMINATION

This report complies with the Lifting Operation and Lifting Equipment Regulations

Certificate Page: 1 Of 4

Date of Thorough Examination: 1/09/2026	Date of Report: 01/09/2026	Report Number: RAS-AM-26093001
---	----------------------------	--------------------------------

<u>Description and identification of the equipment:</u> Lorry Loader Crane, Knuckle Boom, Diesel powered, Hydraulic Operated	Lorry Manufacturer: SCANIA Year of Manufacture: 2005 Model: CR19 Serial Number: 2006129 Chassis Number: YS2R6X40002006129 Plate Number: F 12668 Basra		
	Crane Model Number: F300AXP.24 Crane Serial Number: 4496 Crane Manufacturer: FASSI Year of Manufacture: 2004 Hook Serial Number: 337		
<u>Name and address of employer for whom the thorough examination was made:</u> HANDASAT ARDH AL-KHAIR <u>Address of premises at which the examination was made:</u> RAS YARD / AL-BURJESIA	Crane Capacity: 9.5 Ton Hook Capacity: 11.5 Ton Shackle Capacity: N/A SWL: 9.5 Ton		

EXAMINED IN ACCORDING TO BS 7121-2-4:2013

Description Details of Load Test	Boom Length (m)	Radius (m)	SWL (Ton)	Test Load (Ton)
Load test at 100 % SWL (Min.radius)	2.30	2.30	9500	NIL
Load test at 100 % SWL (Intermediate radius)	6.35	6.35	3970	Function Test
Load test at 100 % SWL (Max.radius)	8.25	8.25	2950	2900

Is this the first examination after installation or assembly at a new site or location?	YES	NO	✓	Was the examination carried out: Within an interval of 6 months?				YES	NO	✓	
					Within an interval of 12 months?				YES	✓	NO
If the answer to the above question is YES, has the equipment been installed correctly?	YES	NO		In accordance with an examination scheme?				YES		NO	✓
				After the occurrence of exceptional circumstances?				YES		NO	✓

Particulars of any repair, renewal or alteration required to remedy the defect identified above: **NONE**

Is the above a defect which is of immediate danger to persons: YES NO ✓

Is the above a defect which is not yet but could become a danger to persons: (if YES state the date by when) **NONE** Yes by:

Identification of any part found to have a defect which is or could become a danger to persons and a description of the defect: **NONE**

Particulars of any test carried out as part of examination:
 -The Equipment Has Been Visual, Function & Performance Tested Satisfactory as per **BS 7121-2-4:2013**.
 - MPI Has Been Done to the Hook According to **ASTME 709**.

IS THIS EQUIPMENT SAFE TO OPERATE? YES ✓ NO

Name & Qualifications of person making this report: Ahmed Yahya	Name of person authenticating this report: Signature: Mustafa Salman	Latest date by which next thorough examination must be carried out: 30/08/2026
---	--	--

Name and address of employer of person making and authenticating this report:
Hussein Ali Hussein, Basra, Burjesia



CERTIFICATE OF THOROUGH EXAMINATION

This report complies with the Lifting Operation and Lifting Equipment Regulations

Report Number: RAS-AM-26093001

Certificate Page: 2 Of 4

GENERAL DESCRIPTION OF THE EQUIPMENT	Status			
	OK	NO	NA	Comments
1 – OPERATOR CAB				
Manufacturer's operation manual	✓			
Load chart & operator competency certificate	✓			
Controls / marking & air condition	✓			
Window / wipers / chair / door look & seals	✓			
Body work	✓			
2 – Boom				
Base section properly attached	✓			
Boom structure	✓			
Boom angle indicator			✓	
Hoist line guides			✓	
3 – Hydraulic System				
Hydraulic oil level	✓			
Outrigger cylinders	✓			
Boom cylinder	✓			
System & Hoses	✓			
4 – Load Hook & Block				
Sheave functions smoothly	✓			
Hook rotates freely lubricated	✓			
Hook latches	✓			
5 – Drum				
Spooling of hoist lines			✓	
Drum shields cracks			✓	
Drum sides cracks			✓	
6 – Hoist line				
Overall condition			✓	
End connections			✓	
Lubricated			✓	
Clips			✓	
7 – Stabilizers				
Stabilizers beam cam	✓			
Stabilizers beam secondary locks	✓			
Stabilizers Hoses & Pipe works	✓			
8 – Loader Crane				
Operation of control levers	✓			
Attachment of loader to vehicle	✓			
Emergency Stop Switches	✓			




CERTIFICATE OF THOROUGH EXAMINATION

This report complies with the Lifting Operation and Lifting Equipment Regulations

Report Number: RAS-AM-26093001

Certificate Page: 3 Of 4

9 – Safety Devices	OK	NO	NA	Comments
Anti-two blocks system	✓			
Warning alarms	✓			
Safety equipment	✓			

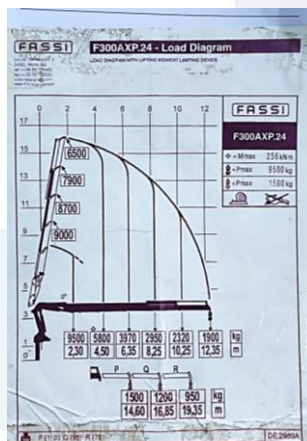

CERTIFICATE OF THOROUGH EXAMINATION

This report complies with the Lifting Operation and Lifting Equipment Regulations

Report Number: RAS-AM-26093001

Certificate Page: 4 Of 4

LOAD TEST & NDT (MPI) REPORT			
Report No:	26093001	Examination Date:	1/09/2026
LOAD TEST			
Equipment Details			
Load Cell Serial No: 30682 / 25532	Vernier Caliper S/N: 400 0576 010	Measuring Tape S/N: N/A	

NDT (MPI) FOR CRANE'S HOOK					
NDT Details					
Standard:	ASTME 709	Equipment type:	PERMENANT YOKE	Contrast Media:	WHITE CONTRAST
Viewing Condition	Colored media	Method	WET	Indicator:	BLACK INK
NDT Equipment Details					
YOKE S/N	A12-512	WHITE CONTRAST	MagnavisWCP-2	BLACK INK	Magnavis7HF
					
Hook Details		Main Hook Serial Number:		337	
		Main Hook SWL:		11.5 Ton	
NDT Procedure					
Visual & MPI CARRIED OUT FOR THE ABOVE DESCRIPTION AND FOUND FREE OF SURFACE DEFECTS AT THE TIME OF INSPECTION					
Identification of any part found to have a defect and a description of the defect: NONE					
Particulars of any repair, renewal or alteration required to remedy the defect identified above: NONE					
ASNT Level II Inspector Name & Signature: Ahmed Yahya			RESULT PASS		

